GMC Acadia instructions (preliminary)

- 1. Jack up truck safely with a 2 post or jack stands
- 2. Remove wheels
- 3. Remove axle nut
- 4. Remove cowl at windshield to get access to upper strut nuts
- 5. Remove sway bar at strut
- 6. Remove upper strut nuts
- 7. Remove lower strut nuts
- 8. Remove strut from vehicle
- 9. Mark studs 20 mm up from strut mount, cut them off. They will hit the Traxda part if you don't cut them
- 10. Install Traxda part with supplied nuts
- 11. Reverse the process, install strut back into vehicle
- 12. Reinstall upper strut nuts
- 13. Reattach sway bar link to strut
- 14. Reinstall axle nut



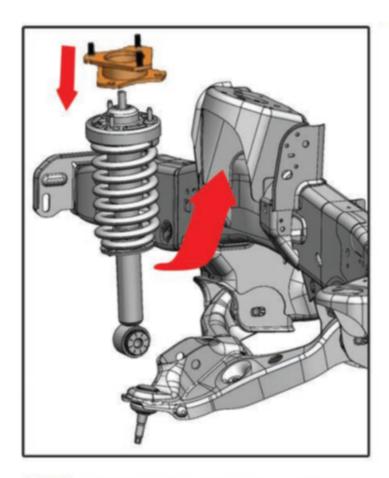


Figure A: Illustration is for reference only. Part dimensions will vary from kit to kit.

REAR

- 1. Remove sway bar link nut at suspension arm
- 2. Remove outer lower control arm bolt
- 3. Loosen inner control arm bolts but do not remove.
- 4. Lower arm down and remove spring

- 5. Place Traxda spacer on top spring isolator\
- 6. Use jack to put control arm back into position
- 7. Reinstall outer lower control arm bolt
- 8. Reinstall sway bar nut
- 9. Re-tighten inner control arm bolts WHEN VEHICLE IS ON THE GROUND Align to stock specs

Rear spacer

